

Software Update for SCS-C5 Configuration Utility

This document provides a comprehensive summary of the Software Update

SCS-C5 Version 7.01.02

Recommended for:

- All C-Series, MCA-Series, and X5 installations

New Features:

- Enabled selection of Digital and Optical options for Audio Input on Sources 3, 4, and 5 when selecting the Device Type 'Russound Media Streamer' to support the new XStream Series products that have Digital and Optical outputs

Bug Fixes:

- AM/FM Tuners such as the ST1 or DMS-3.1 Tuner were switching bands when switching from any source to the Tuner source
- It was possible for System Check to cause an Unhandled Exception error when used with an X5 system
- Incorrect spelling of "Olevia" (was A-levia) in Manufacturer list under DVD Device Types
- Selecting the Manufacturer "RCA" under Television Device Types was causing an Unhandled Exception error
- It was possible for 'Merge IR Database' to cause an Unhandled Exception error

Known Issues:

Issue: Opening a saved MCA-88X project file without launching SCS-C5 first will result in a prompt saying "Project file does not match current project type. Do you want to switch?"

Work around: None. However selecting "Yes" is required. Selecting "No" will result in an Unhandled Exception error

Issue: Changing 'Device Type' for IR Source types will cause signal sensing to be enabled for Power Management

Work around: After changing Device Type simply select Power Management tab and un-check "Use Audio Signal Sensing"

Issue: MCA-88 and MCA-88X projects show Source 7 to be configurable for iBridge Dock which is not a supported configuration

Work around: None, the iBridge Dock source setting dial only goes up to 6 and is fully supported on sources 1-6 of the MCA-88 and MCA-88X

Issue: Zone can be configured for overlapping groups which is not supported and can cause the system to become inoperable

Work around: Do not configure Zones as part of multiple groups. (Example: zones 1 – 6 = Zone Link Group 1, zone 5 & 6 = Zone Link Group 2)

Issue: Adding a Controller to a project file after configuring a Page Source will cause the slave controller zones to have Paging 'Disabled' instead of 'Enabled'. Only Controller #1 will have zones set to 'Enabled'

Work around: Configure Page Source after setting the number of controllers

Issue: Selecting a new X5 project while editing an MCA project applies the saved MCA project name to the new X5 project

Work around: Close SCS and open a new X5 project file instead of opening a new file from within the MCA project file.

Issue: Must disconnect Ethernet to perform MDK update over serial connection using Device Update on MCA-C3 and MCA-C5

Work around: None

Issue: System Check will not show boot version of some products without a write to device

Work around: Write to device prior to running a System Check

For the most recent version of SCS-C5 be sure to visit our support site at: www.russound.com